

ASSEMBLY INSTRUCTIONS FOR ALPHA SERIES TREATMENT TABLES

MODELS 3010, 3020, 3030 & 3013 with ADJUSTABLE BACKREST/KD & Tables with Pre-Attached Backrest For MODELS 3010, 3020, 3030 & 3013 with NON-ADJUSTABLE TOP and PRE-ATTACHED TOPS Skip STEPS 5, through 9

MAXIMUM WEIGHT CAPACITY 450 LBS

Thank you for counting on Clinton to meet your medical equipment needs by purchasing this fine equipment. All Clinton equipment is designed and manufactured to provide years of dependable service because we want you as a customer now and in the future. Below are easy to follow instructions on how to properly assemble your equipment. Please contact us at 800-441-9131 if you experience any difficulty with the assembly or have questions.

INTENDED USE


Clinton treatment tables, models 3010, 3020, 3030 & 3013, are specifically designed and engineered for the use by a single person at a time, who is attended to and observed by trained medical personnel. Never leave anyone on the table unattended. Person's weight and the combination of force exerted on the table during treatment is not to exceed a total of 450 lbs.

KD Quantity	Hardware Package	re-Attached Quantity
(4)	1/4-20 x 1 1/2" Hex Bolts	(4)
(4)	1/4-20 x 1" Hex Bolts	(4)
(2)	1/4-20 x 1" Truss Head Screws	(0)
(4)	¹ /4-20 x 2 ⁵ /8" Truss Head Screws	(0)
(2)	¹ /4-20 x 1" Truss Head Bolts	(0)
(8)	5/16" Washers	(4)
(6)	5/16" Locknuts	(0)
(4)	1/4" Locknuts	(4)
(4)	1 ¹ / ₄ " Black Truss Head Screws (3030 & 3013)	(4)

Tools Required


Wrench & (2) Allen Wrenches Provided Phillips Screwdriver and Adjustable Wrench (not provided)


Open the frame box, remove all packaging and position the table frame upside down on a soft surface that won't mar the top. Position the legs up as shown below.

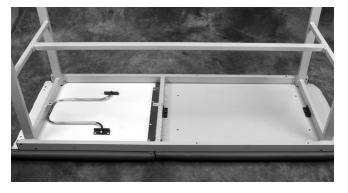

Use the hardware and tools provided to secure the legs into a locked position using the 1/4-20 x 1 1/2" hex bolts and 1/4" locknuts. **DO NOT to tighten at this time.**





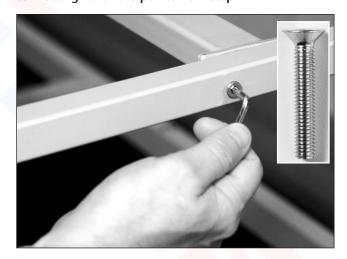

Spin the 4 adjustable feet into the legs. With assistance, invert the table into an upright position on all four legs, using caution when inverting the end with the adjustable headrest.



FOR MODELS WITH ADJUSTABLE BACKREST

Place the black backrest channel on top of the 5 frame tabs with the channel cutouts close to the head end. Secure using (2) $^{1}/_{4}$ -20 x 1" truss head screw and 5/16 locknut at each end.



FOR MODELS WITH ADJUSTABLE BACKREST

Loosely fasten the adjustable backrest hinge to 6 the frame's cross member using (4) $^{1}/_{4}$ -20 x 1 ½" hex bolts, two 5/16" washers (one each side)

and 5/16" locknuts. Note: Hinge flap goes on the black



FOR MODELS WITH ADJUSTABLE BACKREST

Mount the foot end of the top by placing the (4) $^{1}/_{4}$ -20 x 2 $^{5}/_{8}$ " truss head screws through the frame sides and the (2) $^{1}/_{4}$ -20 x 1" truss head screws and ⁵/₁₆" washers at the end mounting points and tightly securing the top. Fully tighten hinge hardware from Step 6.



FOR MODELS WITH ADJUSTABLE BACKREST

Secure all screws in the frame 8



FOR MODELS WITH ADJUSTABLE BACKREST

Secure the middle brace to the top



FOR SAFETY PURPOSES, TAKE TIME TO CHECK ALL SCREWS, BOLTS AND NUTS TO INSURE THAT THEY ARE SECURELY TIGHTENED AND THAT THE TABLE HAS BEEN PROPERLY ASSEMBLED ACCORDING TO THESE INSTRUCTIONS.

PROCEED TO STEPS 10, 11 & 12 ON BACK COVER FOR MODELS 3020, 3030 & 3013

3020 SHELF ASSEMBLY

Invert table to upright position and apply 4 adhesive backed hook and loop strips to top edge of H-braces. Place the full-length shelf on the spanner with the loop strip underside over the hook strips on the braces.




3030 TIER SHELF ASSEMBLY
With table in the upright position, place the full-length shelf into position under the table (see step 10). Using assistance, place tier shelf on the full shelf, aligning it with the end of the shelf that has the pre-drilled holes. (See photo below)





3013 DRAWER ASSEMBLY
With table in the upright position, place the full-length shelf into position under the table (see step 10). Remove the drawers and place the drawer casing into position aligning it with the end of the shelf that has the pre-drilled holes. Fasten unit by screwing the supplied 1 1/4" black truss head screws through shelf and into pre-inserted, threaded inserts. (See photo below).

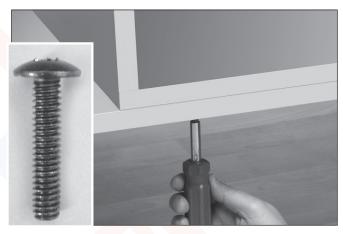

Warranty

Clinton Industries warrants manufactured products to be free of defects in materials, workmanship or design under normal use for five years on all mechanical products and two years on all electrical components from the date of purchase. This warranty does not include damage resulting from accident, abuse or misuse, alteration, or negligence of the product and expressly excludes normal wear of parts (including but not limited to vinyl). Contact Clinton for full warranty details. ANY ALTERATIONS TO OUR PRODUCTS VOIDS ALL WARRANTIES AND CLAIMS.

Care & Cleaning

Clinton products are built to be durable. With proper care, your Clinton equipment will provide years of superior looks and performance. Clean table with a soft cloth and any mild cleaning agent that may be required for sanitation. NEVER use abrasive scrubbing agents that may scratch the surfaces. **Before using any cleaning agents, try them on a small inconspicuous area to insure that they will not harm the any surface.**Damage from cleaning is not covered under the warranty. **Do not use alcohol based cleaning agents.**Periodically check that all fasteners are secure and operating properly.



800-441-9131 • 717-848-3519 Toll-Free Fax 866-522-1233 Fax 717-843-5871 www.clinton-ind.com